

Work F	Permit #	
Work (Order #	
Job#	Activity#	

Nork requester fills out this section.		ing Work Permit		, <u> </u>
Requester: Don Lynch	Date: 06/28/2006	Ext.: 2253	Dept/Div/Group: PO	/PHENIX
Other Contact person (if different from	n requester): S. Marino	Ext.: 3704		
Work Control Coordinator: Don Lync	h	Start Date: 07/17/2006	Est. End Date: 09/15	5/2006
Brief Description of Work: Install TO	F West Detector Array			
Building: 1008	Room: IR	Equipment: n/a	Service Provider: Ph	HENIX
CC, Requester/Designee, Service Pro	ovider, and ES&H (as necessary) f	ill out this section or attach ana	lysis	
ES&H ANALYSIS				
Radiation Concerns	None	Airborne	☐ Contamination	Radiation
Radiation Generating Devices:	Radiography	☐ Moisture Density Gauges	Soil Density Gauges	X-ray Equipment
☐ Special nuclear materials involved	ved, notify Isotope Special Materials	Group	☐ Fissionable materials in	volved, notify Laboratory Criticality Officer
Safety Concerns	☐ None	☐ Ergonomics	☐ Transport of Haz/Rad M	Material
☐ Adding/Removing Walls or Roc	Confined Space*	☐ Explosives	☐ Lead*	☐ Penetrating Fire Walls
Adding/Removing Walls of Roc	☐ Corrosive	☐ Flammable	☐ Magnetic Field*	☐ Pressurized Systems
☐ Asbestos*	☐ Cryogenic	☐ Fumes/Mist/Dust*		☐ Rigging/Critical Lift
☐ Beryllium*	☐ Electrical	☐ Heat/Cold Stress	☐ Noise*	☐ Toxic Materials*
☐ Biohazard*		☐ Hydraulic		☐ Vacuum
☐ Chemicals*	☐ Excavation	☐ Lasers*	Oxygen Deficiency*	☐ Other
* Does this work require medical cle	earance or surveillance from the Occ	cupational Medicine Clinic? X	es 🖂 No	
Environmental Concerns		None	☐ Work impacts Environm	nental Permit No.
Atmospheric Discharges (rad/n	on-rad)	☐ Land Use	Soil	☐ Waste-Mixed
_ · · · · ·	<u> </u>		Activation/contamination	
☐ Chemical or Rad Material Stora	age or Use	Liquid Discharges	☐ Waste-Clean	☐ Waste-Radioactive
☐ Cesspools (UIC)		Oil/PCB Management	☐ Waste-Hazardous	☐ Waste-Regulated Medical
High water/power consumption		Spill potential	☐ Waste-Industrial	Underground Duct/Piping
Maste disposition by:		☐ Opili poteritiai	vvaste-ilidustriai	Other
Pollution Prevention (P2)/Waste I	Minimization Opportunity:	None □ Yes		☐ Ottlei
FACILITY CONCERNS	None	Notic 🔲 Tes		
FACILITY CONCERNS	☐ Electrical Noise	☐ Potential to Cause a	Falsa Alarm	☐ Vibrations
☐ Access/Egress Limitations	☐ Impacts Facility Use /		Temperature Change	Other
☐ Configuration Control	☐ Maintenance Work or		Utility Interruptions	☐ Other
WORK CONTROLS	Walliterlance Work of	11 Veritiiation Systems	U Clinty Interruptions	
Work Practices				
None	Exhaust Ventilation		☐ Spill Containment	Security (see Instruction Sheet)
		Posting/Warning	+=-'	
Back-up Person/Watch Back-up Pers	☐ HP Coverage	Signs	☐ Time Limitation	☐ Other
Barricades	☐ IH Survey	☐ Scaffolding-requires	☐ Warning Alarm (i.e. "hig	ih level")
	In Survey	inspection	Warning Alarm (i.e. riig	
Protective Equipment			T	1 =
None	Ear Plugs	Gloves	Lab Coat	Safety Glasses
Coveralls	☐ Ear Muffs	☐ Goggles	Respirator	Safety Harness
☐ Disposable Clothing	☐ Face Shield	☐ Hard Hat	☐ Shoe Covers	Safety Other
_ '	a valid when is b is selected (<u> </u>	Shoes
Permits Required (Permits must be None		Impair Fire Pretection	- Cuatama	
Concrete/Masonry Penetration	Cutting/Welding	☐ Impair Fire Protection ☐ Rad Work Permit-RV	•	
			VP NO	
Confined Space Entry	☐ Electrical Working Ho	ot Other		
Dosimetry/Monitoring			T	
None	☐ Heat Stress Monitor	Real Time Monitor	☐ TLD	
☐ Air Effluent	☐ Noise Survey/Dosime	Dosimeter	☐ Waste Characterization	
Ground Water	☐ O ₂ /Combustible Gas	Dosimeter	☐ Other	
☐ Liquid Effluent	☐ Passive Vapor Monito	or Sorbent Tube/Filter Pump		
Training Requirements (List below				
PHENIX Awareness, LOTO a	affected, RHIC Access, working at he	eights,		
Based on analysis above, the Waratings below:	Ikdown Team determines the risk	, complexity, and coordination		Il hazard ratings are low, only the following llowed, there is no need to use back of
ES&H Risk Level:		rate High	WCC:	Date:
Complexity Level:	Low Moder	•	Service Provider:	Date:
Work Coordination:	☐ Low ☐ Moder		Authorization to start	Date:
			(Departmental Sun/WCC/De	

Work Plan (procedures, timing, See attached procedure.	equipment, and personnel availability nee	ed to be addressed):				
	ially identical to the work permit # SS-2005 30/06 is now planned to be re-started 7/17			tate RHIC Run 6, The wo	ork described in SS-2005-197 which was	
Special Working Conditions Req No	uired:					
Operational Limits Imposed: No						
Post Work Testing Required:						
Job Safety Analysis Required: [☐ Yes ⊠ No	1	Walkdown Required: ⊠ Yes ☐ No			
Reviewed by: Primary Reviewe that the hazards and risks that or	er will determine the size of the review tear ould impact ES&H have been identified an	m and the other signated will be controlled ac	ures required based cording to BNL required	on hazards and job com rements.	plexity. Primary Reviewer signature means	
Title	Name (print)	Signature	Life		<u>Date</u>	
Primary Reviewer						
ES&H Professional						
Other						
Other						
Work Control Coordinator	Don Lynch		201	146	9/24/2005	
Service Provider	2025				3,2 ,,2333	
30111001110111001	Review Done: in series	☐ team				
	TREVIEW BOILE. III 301103	Lean				
Job site personnel fill out this sect						
Note: Signature indicates person	nnel performing work have read and under	rstand the hazards and	d permit requirements	s (including any attachm	ents).	
Job Supervisor:		(Contractor Supervisor:			
Workers:	Life#:	\	Workers: Life#:		ife#:	
Workers are encouraged to provi	ide feedback on ES&H concerns or on ide	as for improved job w	ork flow. Use feedba	ack form or space below.		
Departmental Job Supervisor, Wor	k Control Coordinator/Designee					
	art work: (Permit has been reviewed, work	controls are in place	and site is ready for j	ob.)		
Name:	Name: Signature:		Life#:		Date:	
Congression Mor	k Paguantar/Danignan datarminan if Da	at Joh Paviaw ia rag	uired D Vee D	No		
Post Job Review (Fill in names of	k Requester/Designee determines if Post of reviewers)	St Job Review is req	uirea. 🔛 Yes 🔛	NO		
Name:	Signature:	ı	Life#:		Date:	
Name:	Signature:	I	Life#: Da		Pate:	
Norker provides feedback.						
Worker Feedback (use attached a) WCM/WCC: Is any feedback						
b) Workers: Are there better me	ethods or safer ways to perform this job in	the future? Yes	□ No			
Closeout: Work Control Coordinate	or (authorizing dept.) checks quality of o	completed permit an	d ensures the work	site is left in an accept	able condition. (WCC can delegate	
Name:	Signature:	Li	 Life#:		Date:	
Comments:	1 0					

WP#

Install Time of Flight West Detectors PHENIX IR, Bldg. 1008

Discussion

A new array of detectors has been designed and built for the PHENIX experiment at the Relativistic Heavy Ion Collider. The design concept for the detectors has been reviewed by appropriate PHENIX technical staff and a safety review by CA safety staff has been conducted during which the concept for this work plan was presented.

The detector is comprised by 4 identical separate enclosures which each house ¼ of the detector modules and associated onboard electronics. The enclosures provide a leak tight environment for the detectors which have a 95% R134A 5% Isobutane local gas environment. On the exterior of the enclosure preamp printed circuit boards are attached, from which signal cables and low voltage cables are routed to a common edge of the enclosure. High voltage cables and gas piping are fed to the interior of the enclosures from the same common edge. When mounted this common edge will form the vertical edge of the enclosures, 2 on the north side of the detector array and 2 on the south side. The detector array assembly of the 4 enclosures will be located in the annular space on the west carriage in the vertical sector (sector 2) outboard of the existing Aerogel detector and inboard of Pad Chamber 3.

The detector enclosures will be installed 2 at a time "garage door style" from the top of the west carriage and staged off of the Bridge platform above the central magnet. The detectors will be joined with a set of brackets and long 3" I-beams which support the assembly from above and below. A set of aluminum channels has been installed in the west carriage to guide the descent of the detectors into place, as they are lowered down using 2 steel cables driven by a motor and spool assembly originally fabricated for the (similar) installation of the Pad Chamber detectors.

In order to install the detectors in this manner, 2 seismic restraints on the RICH detector and some local piping for the flammable gas detection system must be temporarily removed. The location of these items is inaccessible form any existing platforms, and as such a custom designed access platform has been designed for this purpose.

The delicate nature of this work dictates that the installation technique be tested and practiced. For that purpose a geometrically similar mock up has been fabricated to exercise the procedure.

This work is to be done by fully trained and experienced PHENIX personnel, under the technical supervision of Sal Marino and the engineering cognizance of Don Lynch. The custom platform is an existing purchased 16' work platform manufactured by Werner, Inc. and rated for 500 lbs. This platform will not be modified in any way and

will be supported by 3/4" steel threaded rod attached to 4" aluminum structural channel below the platform. The threaded rod is supported from two 16' long 4" aluminum structural channels. Access to the Werner platform will be provided via a 6 ft A-frame ladder on the Werner platform secured to the bridge platform.

All persons involved will have appropriate training for working at heights, fall protection and all other relevant training.

Procedure

LOTO the power to the MMS magnet coil at the power supply in1008B. (Pearson)

Verify that no gas is flowing to any of the chambers. (Biggs)

Assure that the CM is locked in position by locking out the hydraulics to each magnet mover. (Marino)

(Note all persons working on the Bridge platform while any decking is removed shall have appropriate fall protection equipment on and secured to the Bridge structural supports.)

1. Access Platform Installation

- a. Hoist the Werner platform already assembled with its lower channel supports onto the Bridge platform using the IR 1 crane. Also use the crane to hoist the 16' aluminum channel platform supports to the Bridge platform.
- b. Remove the 2 westernmost 2 rows of Bridge platform grating and position the Werner platform such that its south end can be inserted through the opening in the Bridge decking
- c. Insert the Werner platform under the Bridge support beams, gradually moving the Werner platform south interchanging support straps as the platform passes each of the structural supports until the entire platform has been inserted and is under the Bridge.
- d. With the Werner platform just under the Bridge structural beams and fully supported by the crane, attach the four ¾ inch threaded rods securely to the lower channel supports. Attach cross bracing at the north and south ends of the platform.
- e. Lower the Werner platform to its desired level then assemble the 16' platform support channels and upper support channels as indicated on the

attached illustrations

- f. Secure a 6 ft A-frame ladder to the structural beams of the Bridge for access and egress to and from the Werner platform.
- g. After the platform is firmly in place and before the platform is used for any access tasks, the installation is to be inspected by CA safety personnel or their designees.

2. Removal of seismic restraints and Flammable gas detection piping

- a. Before removing any of the fasteners holding the RICH seismic restraints, attach the restraint to the IR crane and take any slack up.
- b. From the uppermost "window washer" platform on the west carriage, climb to the top of the structure and reach over to remove the top fasteners from the restraint.
- c. Access the bottom fastener of the restraint from the Werner platform and remove it
- d. Use the crane to hoist the restraint to the Bridge platform where it shall be secured until ready to be reinstalled.
- e. Take digital photos of the flammable gas piping in the area involved in the installation to assist in the reinstallation of this equipment later.
- f. Carefully remove any flammable gas detection piping which would otherwise interfere with the installation process.

3. Mock-up Installation

- a. Install the bottom-most v-block detector support in the sector 2 north and south rails at their design locations.
- b. Install the channel extensions to the uppermost TOF West guide channels at the north and south end.
- c. Install the metal rope drive assembly to the channel extensions and secure to the Bridge structural frame.
- d. Hoist the mockup assembly to the bridge using the IR crane, lower the assembly into the channel extension through the slots provided and continue lowering the mockup until all 4 guide rollers are in the guide rail and contacting the guide surface.

- e. Attach the wire ropes to the north and south eyebolts, reverse the drive to remove any slack in the wires until the full load is on the wire ropes.
- f. Remove the IR crane sling and lift the IR crane away from the work area and stow the hook at its highest point.
- g. Switch the wire rope drive to its normal direction and slowly lower the mockup to its final destination, stopping periodically to check for any snags or unexpected interferences. Note any problems or irregularities.
- h. When the lower roller wheels contact the support v-blocks, install the upper v-blocks to fully support the mockup.
- i. Remove the wire ropes and practice retracting wire ropes.
- j. Check the adjusting capabilities of the v-blocks and associated adjustment hardware for travel and suitability for the task. Note any problems or irregularities.
- k. Lower the wire ropes back to the mockup and reattach.
- 1. Remove the upper v-blocks and upper adjustment hardware.
- m. Hoist the mockup back up the guide rails until it reaches its upper limit of travel in the channel extensions.

4. Evaluate Installation Procedure

Based on the experience evaluate the procedure described above and its probability of success in installing the actually detectors. If necessary, revise the procedure above and or installation fixtures, adjusting hardware etc. as appropriate. Record any minor changes or corrections on a separate sheet and attach to the work permit. Any major changes in procedure or equipment design shall require a new work permit. After any changes are made step 3 and all substeps shall be repeated to verify the revised procedure unless deemed unnecessary by the cognizant engineer.

5. Pre-Detector Installation Test


After completion of the mockup test, it is expected that there will be a period of time before the actual detector is ready for installation. The cognizant engineer in consultation with CA safety representatives or their designees shall determine what steps are necessary to maintain the installation setup in a safe condition. In no event shall the equipment designed for the TOF West installation be used for other purposes unless a detailed separate approved work order is in place.

6. **Detector Installation**

- a. Follow the verified procedure used for the mockup to install the lower detector half to the point where the upper adjustment v-block supports are installed.
- b. Detach the wire rope from the upper ibeam..
- c. Retract the wire ropes to the Bridge.
- d. Install the lower v-block support for the upper detector half on both the north and the south ends.
- e. Attach the upper I-beam to the upper detector half and hoist the assembly to the extension channels and lower the assembly until all 4 rollers are contacting the guide rail channels.
- f. Lower the upper half of the detector assembly into place as before until nested lower v-block supports.
- g. Remove the wire ropes from the upper I-beam and retract the ropes back into their respective spools.
- h. Survey and adjust the v-block support adjustments as necessary to align the detectors within their required specifications.
- i. Disassemble the installation fixtures in the reverse order that they were installed (as described above).
- i. Reinstall the RICH seismic restraints.
- k. Reinstall the flammable gas detector piping and instrumentation, referring to the photos of the original installation for guidance.
- 1. Remove the Werner platform by following the above installation procedure in reverse.

Refer to the attached illustrations for further information.

Installation

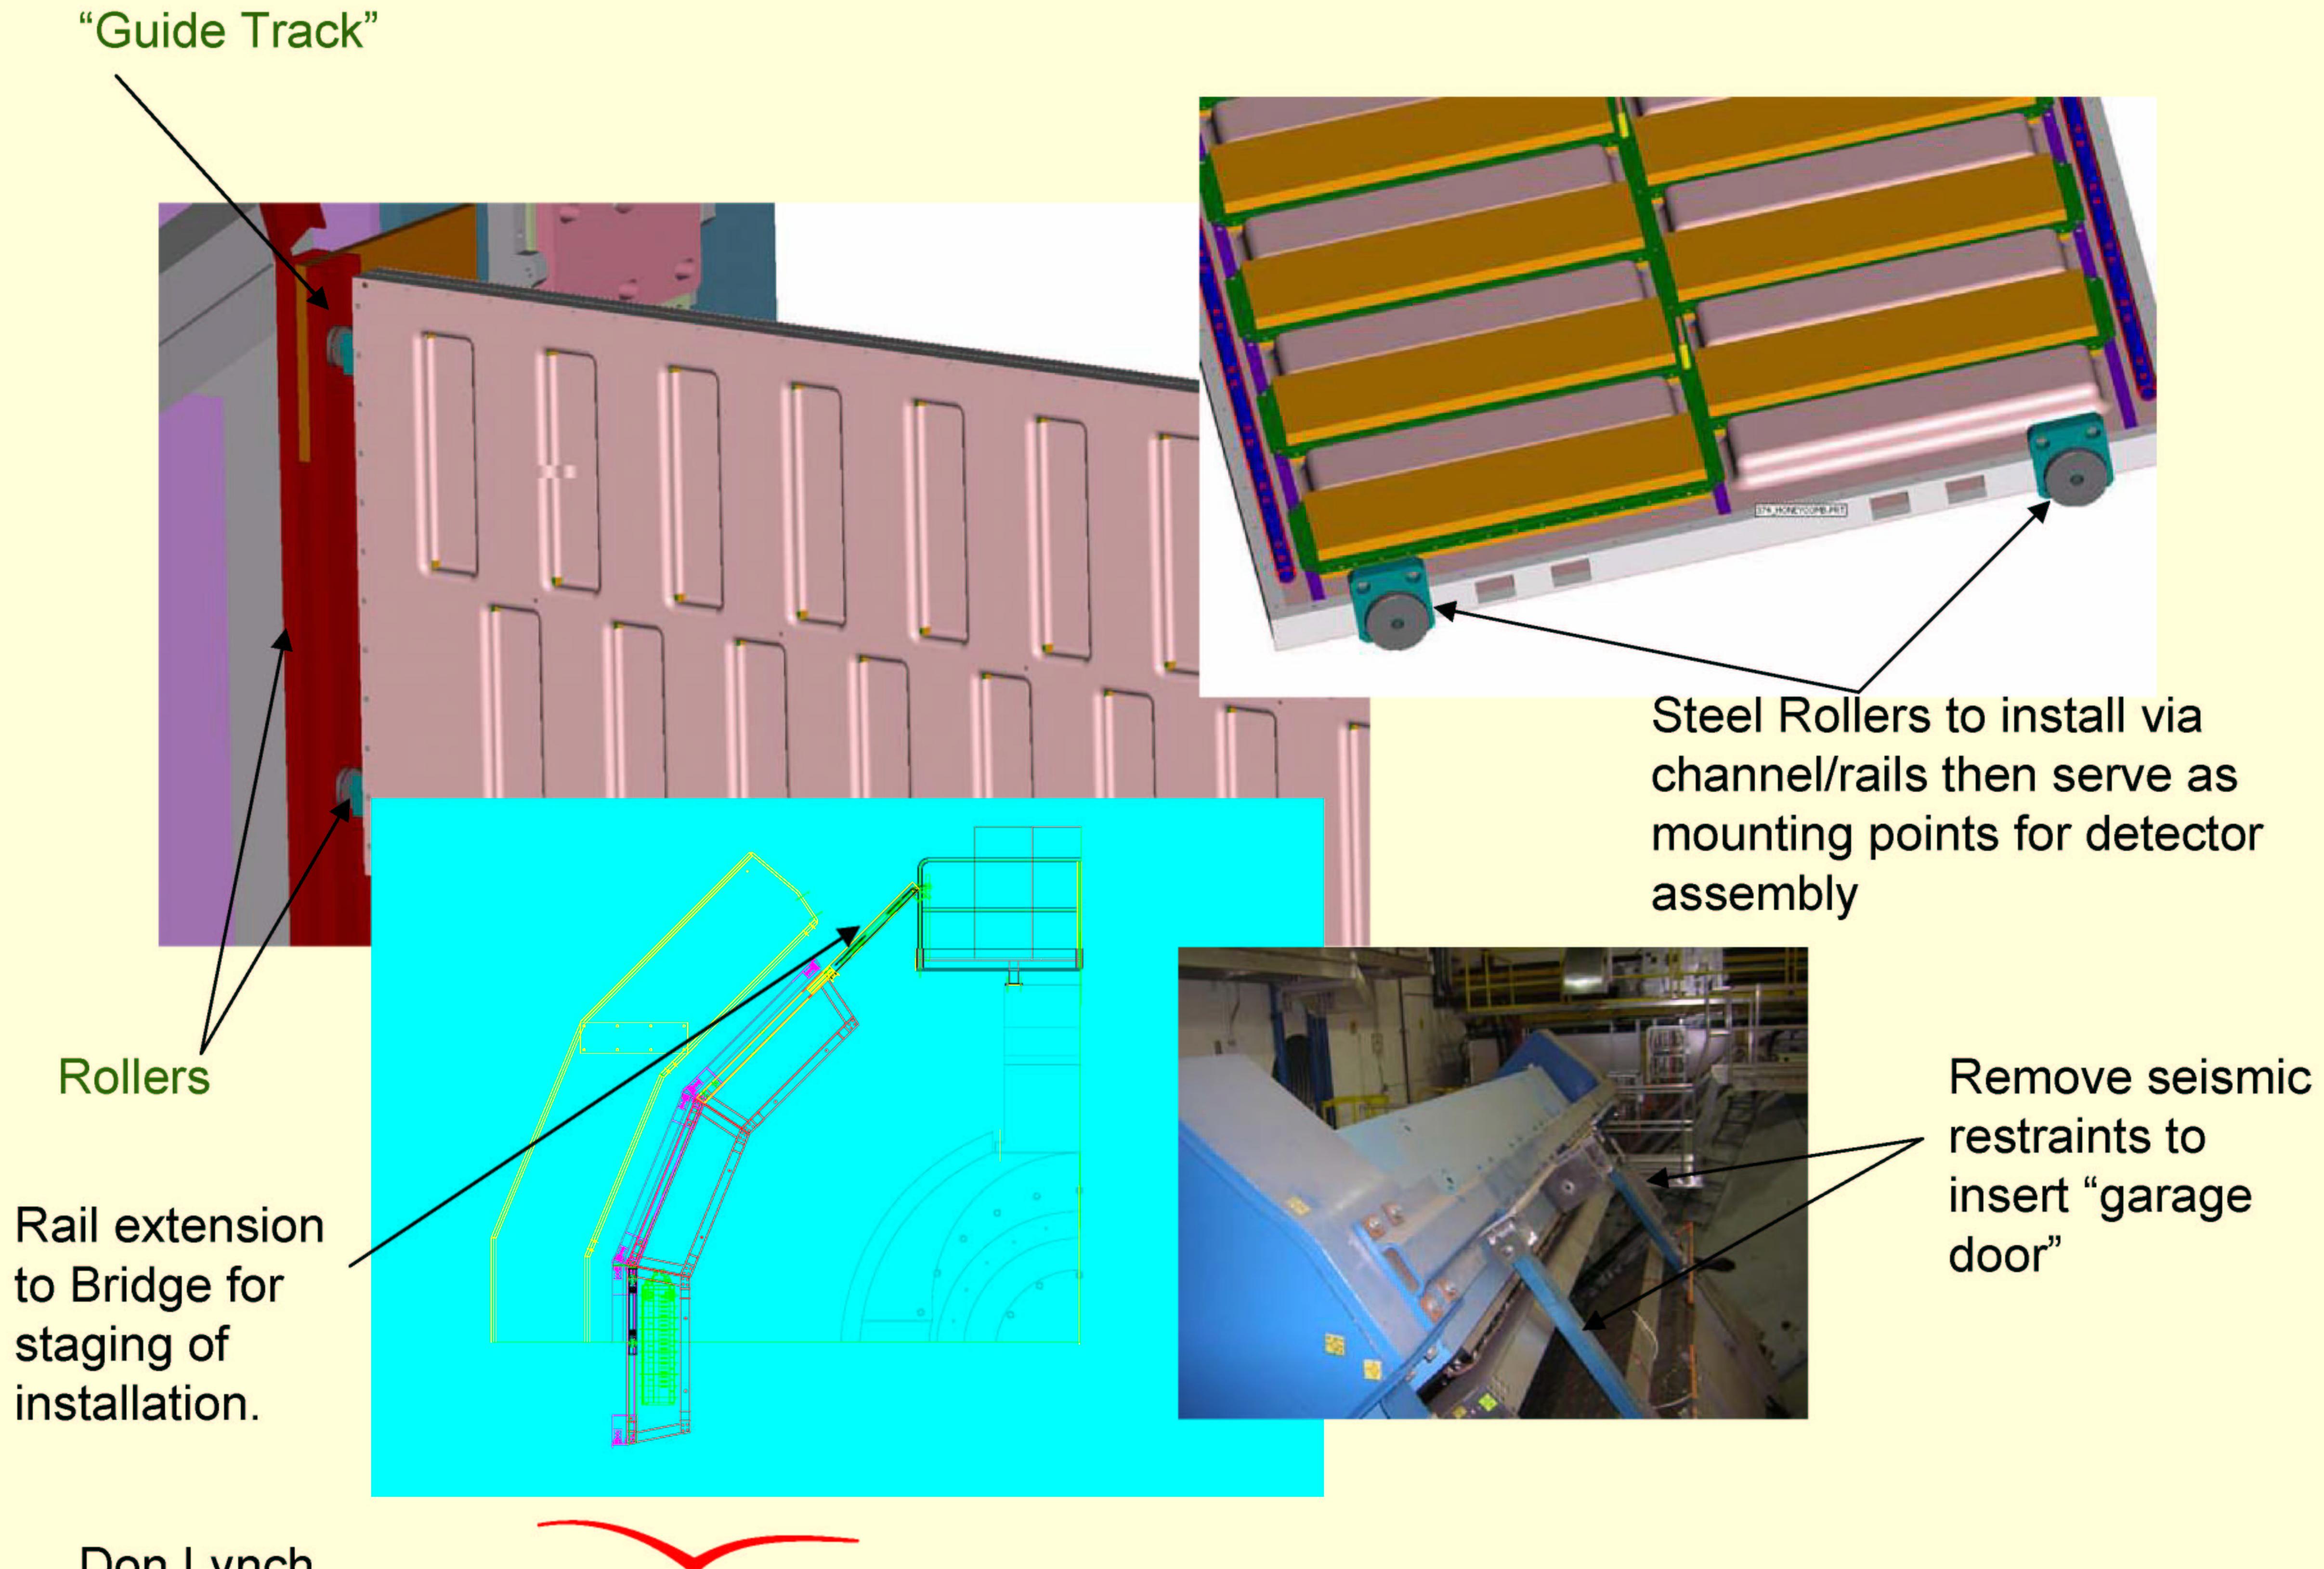

Don Lynch 9/15/05

Alum. Channel

